

Location (Room #)	Assessment Date	Building Materials Impacted	Present Condition	Estimated Quantity of Impacted Material	Mold Confirmation Swab Sample Collected	Moisture (%)	Humidity (%)	AAIS response needed	Remediation Completed	Post-Clean Swab Collected	Suspect Source	Comments
		SR, CT, PI, DI	VG, VS, NVG, NVS		(Yes/No)				(yes/No)			
Upper Corridor - South	8/25/21	SR, CT, PI, DI	VG, VS (PI)	SR (20 SF), CT (5 tiles), PI (10 LF), DI (10 LF)	Yes	SR 18.3, CT 94.8	74	clean/disinfect	Yes	No	condensation on duct/pipe insulation	SR -requires asbestos abatement
Stairwell B	8/25/21	-	NVS, NVG	-	No	-	70	-	-	-	-	-
Rm 1	8/25/21	metal ceiling deck	VS, NVG	-	Yes	-	73	-	-	-	-	deck appears to be rusted
Rm 2	8/25/21	-	NVS, NVG	-	No	-	73	-	-	-	-	visible condensation on pipe insulation
Rm 3	8/25/21	-	NVS, NVG	-	No	-	76.6	-	-	-	-	visible condensation on pipe insulation
Rm 4	8/25/21	metal desk, SR	NVS, VG	1 desk, SR (12 SF)	Yes (2)	SR 20.3	78.3	desk to be cleaned	Yes	Yes	-	SR- Island Ceiling
Rm 5	8/25/21	-	NVS, NVG	-	No	-	81.2	-	-	-	-	visible condensation on pipe insulation
Rm 6	8/25/21	-	-	-	-	-	-	-	-	-	-	inaccessible
Rm 7	8/25/21	-	NVS, NVG	-	No	SR 18.9	80.9	-	-	-	-	visible condensation on pipe insulation
Rm 8	8/25/21	PI	VS, VG	2 LF	Yes	PI 16.0	79.7	clean/disinfect	Yes	Yes	condensation from HVAC	-
Copy Room	8/25/21	-	NVS, NVG	-	No	-	77.5	-	-	-	-	-
Office	8/25/21	-	NVS, NVG	-	No	SR 20.3	68.3	-	-	-	-	-
Asst. Principal Office	8/25/21	-	NVS, NVG	-	No	-	67.1	-	-	-	-	-
Principal Office	8/25/21	-	NVS, NVG	-	No	-	67.1	-	-	-	-	-
Main Office	8/25/21	CT	VS, NVG	3 CT	No	CT 12.8	67.1	remove tiles	Yes	No	condensation from pipe	-
Conference Room	8/25/21	-	NVS, NVG	-	No	-	67.1	-	-	-	-	-
Upper Corridor - East	8/25/21	-	VS, NVG	1 CT	No	CT 13.9	80.1	remove tiles	Yes	No	-	-
Rm 8A	8/25/21	-	NVS, NVG	-	No	-	61.9	-	-	-	-	-
Rm 8B	8/25/21	-	NVS, NVG	-	No	-	83.1	-	-	-	-	cardboard vent cover 14.3% moisture
Rm 8C	8/25/21	-	NVS, NVG	-	No	SR 9.1	81.5	-	-	-	-	-
Main Lobby	8/25/21	-	NVS, NVG	-	No	SR 18.9	81.5	-	-	-	-	-
Stairwell A	8/25/21	-	NVS, NVG	-	No	-	78	-	-	-	-	-
Vestibule	8/25/21	-	NVS, NVG	-	No	-	81.5	-	-	-	-	-
Rm 9	8/25/21	-	NVS, NVG	-	No	-	73.5	-	-	-	-	visible condensation on pipe insulation
Rm 10	8/25/21	metal ceiling deck	VS, NVG	CD 20 SF	No	SR 14.8	73.6	-	Yes	No	deck appears to be rusted	-
Rm 11	8/25/21	-	NVS, NVG	-	No	SR 13.4	57.9	-	-	-	-	-
Rm 12	8/25/21	-	NVS, NVG	-	No	-	60	-	-	-	-	-
Rm 13	8/25/21	-	NVS, NVG	-	No	SR 13.1	0.6	-	-	-	-	-
Rm 14	8/25/21	particle board (sink bottom), SR	VS, VG	PB (6 SF under sink), SR (21 SF)	Yes	PB 32.0	61.8	clean/disinfect PB and SR	Yes	Yes	condensation	-
Rm 15	8/25/21	ceiling deck	VS, NVG	-	No	SR 11.6	57.4	-	Yes	No	-	deck appears to be rusted
Rm 17	8/25/21	ceiling deck, SR	NVS, VG	CD (140 SF), SR (35 SF wet)	Yes	SR 11.5	57.4	-	Yes (ceiling)	Yes (ceiling)	-	visible growth on ceiling deck above SR, NE corner SR wet on lower half but no growth or staining
Rm 17A	8/25/21	-	NVS, NVG	-	No	SR 11.0	57.4	-	-	-	-	SR-requires asbestos abatement
Boys RR by Rm 14	8/25/21	-	NVS, NVG	-	No	-	54.8	-	-	-	-	-
Girls RR by Rm 19	8/25/21	-	NVS, NVG	-	No	-	55	-	-	-	-	no AC, NE corner SR wet on lower half but no growth or staining
Rm 19	8/25/21	-	NVS, NVG	SR (8 SF wet)	No	SR 21.2	53.8	remove SR	-	-	-	SR-requires asbestos abatement
Upper Corridor - North	8/25/21	CT	VS, NVG	CT (3 tiles)	No	CT 54	60.8	remove tiles	Yes	No	condensation	-
Custodian Closet	8/25/21	-	-	-	-	-	-	-	-	-	-	inaccessible
Kiln Room	8/25/21	-	NVS, NVG	-	No	-	57.2	-	-	-	-	-
Rm 16/18 (Nurses Office)	8/25/21	CT	VS, NVG	CT (3 tiles)	No	CT 7.6	62.1	remove tiles	Yes	No	condensation	-
Rm 19A	8/25/21	-	NVS, NVG	-	No	-	57.2	-	-	-	-	-
Portable Corridor	8/25/21	-	NVS, NVG	-	No	-	65	-	-	-	-	-
Portable 1	8/25/21	CT	VS, VG	CT (7 tiles)	Yes	CT 34.6	66.8	remove tiles	Yes	No	condensation	no insulation above ceiling tiles
Portable 2	8/25/21	vinyl track on ceiling, CT	NVS, NVG	20 LF, CT (5 tiles)	Yes	VT 16.8	64.5	clean/disinfect vinyl, remove tiles	Yes	Yes	condensation	-
Portable 3	8/25/21	CT	VS, NVG	CT (3)	No	CT 15.8	67.3	remove tiles	Yes	No	condensation	-
Portable 4	8/25/21	CT, DI	VS, NVG	CT (1)	No	DI 64.6	65.5	remove tiles	Yes	No	condensation	-
Portable 5	8/25/21	CT	VS, NVG	CT (2)	No	32.5	65.5	remove tiles	Yes	No	condensation	-
Rm 20	8/25/21	-	NVS, NVG	-	No	-	65.6	-	-	-	-	visible condensation on pipe insulation
Rm 21	8/25/21	-	NVS, NVG	-	No	-	64.8	-	-	-	-	-
Rm 22	8/25/21	-	NVS, NVG	-	No	-	66.5	-	-	-	-	-
Rm 23	8/25/21	-	NVS, NVG	-	No	SR 16.7	64.7	-	-	-	-	-
Rm 24	8/25/21	-	NVS, NVG	-	No	-	68.7	-	-	-	-	visible condensation on pipe insulation
Rm 25	8/25/21	particle board (sink bottom), PI	VS, NVG	1 SF, 1 LF	No	PB 32.8, SR 16.2	65.8	clean/disinfect	Yes	No	-	visible condensation on pipe insulation

Boys RR by Rm 25	8/25/21	-	NVS, NVG	-	No	-	68.5	-	-	-	-	-	-
Girls RR by Rm 26	8/25/21	-	NVS, NVG	-	No	-	69.3	-	-	-	-	-	-
Rm 26	8/25/21	PI	NVS, VG	2 LF	Yes	SR 20.5	67.4	clean/disinfect	Yes	Yes	-	-	encapsulated PI with Kilz
Rm 27	8/25/21	particle board	VS, VG	1 SF	No	PB 20.9, SR 19.7	67	clean/disinfect	Yes	No	-	-	-
Rm 28	8/25/21	ceiling deck, SR, PI	VS, VG	20 SF (CD), 1 SF (PI)	No	SR all around classroom measuring above	68	clean/disinfect	Yes	No	-	-	visible condensation on pipe insulation
Rm 30A	8/25/21	-	NVS, NVG	-	No	-	65.7	-	-	-	-	-	-
Upper Corridor - West	8/25/21	CT	VS, NVG	CT (3 tiles)	No	CT 32.0	67.3	remove tiles	Yes	No	-	-	-
Mens Faculty RR	8/25/21	-	NVS, NVG	-	No	-	64.4	-	-	-	-	-	-
Womens Faculty RR	8/25/21	-	NVS, NVG	-	No	-	64.3	-	-	-	-	-	-
Office	8/25/21	-	NVS, NVG	-	No	-	64.2	-	-	-	-	-	-
Rm 28C (Conference Room)	8/25/21	CT	VS, NVG	CT (1 tile)	No	60.5	64.3	remove tile	Yes	No	-	-	visible condensation on valve
Room 28A (Psychologist)	8/25/21	-	NVS, NVG	-	No	11.1	64.3	-	-	-	-	-	-
Stairwell C	8/25/21	-	NVS, NVG	-	No	-	65.3	-	-	-	-	-	-
Rm 29	8/25/21	ceiling deck, SR	VS, VG	SR (6 SF)	Yes	SR 17.5	57.7	clean/disinfect	Yes	Yes	-	-	-
Rm 30	8/25/21	PI	VS, VG	2 LF	No	SR 12	56.9	clean/disinfect	Yes	No	-	-	-
Rm 31	8/25/21	PI	VS, VG	1 LF	No	SR 17.5	62.4	clean/disinfect	Yes	No	-	-	-
Rm 32	8/25/21	ceiling deck, PI	VS, NVG	PI (2 LF)	No	-	68.1	clean/disinfect	Yes	No	-	-	-
Rm 33	8/25/21	-	NVS, NVG	-	No	18.1	69.4	-	-	-	-	-	-
Rm 34	8/25/21	-	NVS, NVG	-	No	-	70.8	-	-	-	-	-	visible condensation on pipe insulation
Rm 35	8/25/21	particle board	VS, NVG	1 SF	No	PB 28.6, SR 16.7	76	clean/disinfect	Yes	No	-	-	-
Rm 36A	8/25/21	-	NVS, NVG	-	No	SR 15.2	76	-	-	-	-	-	-
Rm 36	8/25/21	PI	VS, VG	1 SF	No	-	78.9	clean/disinfect	Yes	No	-	-	-
Rm 37	8/25/21	ceiling deck	NVS, VG	3 SF	No	SR wall 25.5, SR island 16.5	75	-	-	-	-	-	deck appears to be rusted
Rm 35A	8/25/21	-	NVS, NVG	-	No	-	76.3	-	-	-	-	-	-
Upper Teachers' Lounge	8/25/21	-	NVS, NVG	-	No	-	77	-	-	-	-	-	-
2A Conference	8/25/21	-	NVS, NVG	-	No	-	78	-	-	-	-	-	-
Elevator Lobby	8/25/21	CT	VS, NVG	1 CT	No	-	72	remove tile	Yes	No	-	-	-
Middle Corridor - South	8/25/21	CT	VS, NVG	1 CT	No	CT 15.8	70	remove tile	Yes	No	-	-	-
Teachers' Lounge	8/25/21	-	NVS, NVG	-	No	-	78.8	-	-	-	-	-	-
Mens Faculty RR	8/25/21	-	NVS, NVG	-	No	-	78.8	-	-	-	-	-	-
Womens Faculty RR	8/25/21	-	NVS, NVG	-	No	-	78.8	-	-	-	-	-	-
Rm 38	8/25/21	bookcases	VS, VG	full unit	No	-	78.3	clean/disinfect	Yes	No	-	-	-
Rm 40	8/25/21	bookcases	VS, VG	full unit	No	SR island 18.4	80.1	clean/disinfect	Yes	No	-	-	-
Rm 42	8/25/21	bookcases	VS, VG	full unit	No	SR island 17.8	78.5	clean/disinfect	Yes	No	-	-	-
Media Center	8/25/21	CT	VS, NVG	10 CT	No	SR 15.5	82.5	remove tiles	Yes	No	-	-	-
Rm 41A	8/25/21	CT	VS, NVG	1 CT	No	-	80.1	remove tile	Yes	No	-	-	-
Rm 41B	8/25/21	-	NVS, NVG	-	No	SR 16.3	79.7	-	-	-	-	-	-
Boys Restroom by Rm 44	8/25/21	-	NVS, NVG	-	No	-	79.7	-	-	-	-	-	-
Girls Restroom by Rm 44	8/25/21	-	NVS, NVG	-	No	-	79.7	-	-	-	-	-	-
Rm 43	8/25/21	CT	VS, NVG	4 CT	No	-	75.5	remove tiles	Yes	No	-	-	-
Rm 45	8/25/21	-	NVS, NVG	-	No	-	74.5	-	-	-	-	-	-
Rm 47 (Small Storage)	8/25/21	CT	VS, VG	2 CT	Yes	-	74.5	remove tiles	Yes	No	-	-	AHU Condensate
Rm 44	8/25/21	-	NVS, NVG	-	No	SR 18.0	75.5	-	-	-	-	-	-
Middle Corridor - East	8/25/21	-	NVS, NVG	-	No	SR 16.5	74.5	-	-	-	-	-	-
Mechanical Room by Stair A	8/25/21	PI	VS, NVG	5 LF	No	SR 16.2	74.5	clean/disinfect	Yes	No	-	-	-
Rm 46	8/25/21	bookcases, bench	VS, VG	full unit	No	SR wall at sink	27.8	70.9	clean/disinfect	Yes	Yes	-	-
Rm 47 (Large Storage)	8/25/21	PT items	NVS, NVG	misc. items (20)	No	12.3	71.2	clean/disinfect	Yes	Yes	-	-	some items bagged
Rm 48	8/25/21	bookcases	VS, VG	full unit	No	SR wall at sink	15.5	69.3	clean/disinfect	Yes	Yes	-	-
Rm 50	8/25/21	bookcases	VS, VG	full unit	No	SR wall at sink	20.5	69.3	clean/disinfect	Yes	No	-	-
Play Area	8/25/21	CT	VS, NVG	3 CT	No	SR 15.3	70.8	remove tile	Yes	No	-	-	-
Rm 49A	8/25/21	concrete	NVS, NVG	-	No	20.1	70.6	clean/disinfect	Yes	No	-	-	bubbling paint on north wall
Storage by Rm 49A	8/25/21	-	NVS, NVG	-	No	-	71.2	-	-	-	-	-	inaccessible
Small Storage	8/25/21	-	NVS, NVG	-	No	13.8	71.2	-	-	-	-	-	-
Mechanical Room (Small)	8/25/21	concrete	NVS, NVG	20 SF	No	22.5	70	-	-	-	-	-	bubbling paint on north wall
Mechanical Room (Large)	8/25/21	DI	VS, NVG	3 LF of canvas	No	16.5	68.1	clean/disinfect	Yes	No	-	-	rust staining on duct
Storage by Lg Mech Room	8/25/21	-	NVS, NVG	-	No	16.7/SR	69.2	-	-	-	-	-	rust staining on deck
Lower Corridor - Center	8/25/21	-	NVS, NVG	-	No	-	67.4	-	-	-	-	-	-
Cafeteria	8/25/21	CT	VS, NVG	5 CT	No	20.1	66.4	remove tile	No	No	-	-	-
Teachers Dining	8/25/21	CT	VS, VG	3 CT	No	14.2	68.6	remove tile	Yes	No	-	-	-
Café Storage	8/25/21	-	NVS, NVG	-	No	14.2	68.6	-	-	-	-	-	-
Kitchen	8/25/21	CT	VS, NVG	1 CT	No	15.4	66.8	remove tile	Yes	No	-	-	grease staining throughout on CT
Gym Storage	8/25/21	-	NVS, NVG	-	No	-	68.2	-	-	-	-	-	inaccessible
Gym	8/25/21	CT	VS, NVG	20 CT	No	-	68.2	remove tile	No	No	-	-	concrete walls
P.E. Office	8/25/21	-	NVS, NVG	-	No	-	68.2	-	-	-	-	-	inaccessible

Boys RR by PE Office	8/25/21	-	NVS, NVG	-	No	-	69.2	-	-	-	-	
Girls RR by PE Office	8/25/21	-	NVS, NVG	-	No	-	69.5	-	-	-	-	
Custodian Office	8/25/21	SR	VS,VG	SR (100 SF), PI (2 LF)	Yes	SR 43.2	74.2	clean/disinfect	Yes (PI)	No	-	SR -requires asbestos abatement
Boiler Room	8/25/21	PI	VS,VG	SR (100 SF), PI (40 LF)	No	-	74.2	clean/disinfect	No	-	-	SR -requires asbestos abatement
Generator Room	8/25/21	SR ceiling	VS,VG	SR (30 SF)	No	-	74.2	clean/disinfect	No	-	-	SR -requires asbestos abatement
Electrical Room	8/25/21	SR	VS,NVG	10 LF	No	-	74	-	-	-	-	rust staining at base of switch gear

Legend:
SURVEY PERFORMED BY: Randy Taylor and John R. Hobbins
LF = LINEAR FEET, SF = SQUARE FEET, EA = EACH
VG = VISIBLE MOLD GROWTH, VS = VISIBLE STAINING, NVG = NO VISIBLE GROWTH, NVS = NO VISIBLE STAINING
SR = SHEETROCK, CT = CEILING TILE, PI = PIPE INSULATION, FGPI = FIBERGLASS PIPE INSULATION, DI = DUCT INSULATION AHU = AIR HANDLER UNIT